



WICHTIGER MONTAGEHINWEIS

Kraftstofffördereinheit 2250543


Vor dem Austausch der Kraftstofffördereinheit bitte die Steckkontakte auf Auffälligkeiten prüfen.

Sollten sie eine Verfärbung an den Kontakten, am Kunststoff oder Scheuerstellen an dem Stecker feststellen, müssen weitere Teile mit ausgetauscht werden.

Durch einen zu geringen Abstand zwischen dem Anschlussstecker, der Pumpeneinheit und der Karosserie kann es bei ungünstiger Konstellation zum Kontakt kommen. Dieser Kontakt kann Hochspannungsimpulse verursachen und in der Folge zu einem Überhitzen der Steckkontakte und zum Schmelzen des Kunststoffes führen.

Bei der Montage auf korrekte Verriegelung des Steckers achten.

Bitte verwenden Sie beim Austausch der Kraftstofffördereinheit zusätzlich folgenden Metzger Kabelreparatursatz: 2324101.

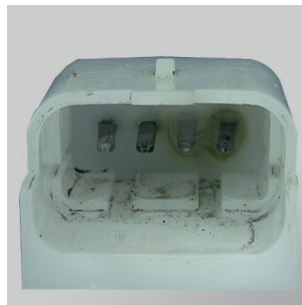



IMPORTANT INSTALLATION NOTICE

Fuel feed unit 2250543

Before replacing the fuel feed unit, please check the plug contacts for abnormalities.

If you notice any coloration on the contacts, on the plastic or chafe marks on the plug, other parts must be also be replaced.

If the distance between the connecting plug, the pump unit and the car body is too small, contact may occur if the constellation is unfavourable. This contact can cause high-voltage pulses and lead to overheating of the plug contacts and melting of the plastic.

When installing, ensure that the plug is correctly locked in place.

Please also use the following Metzger cable repair kit to replace the fuel feed unit: 2324101.

